

# HEIDENHAIN



# **TNC 320**

Compact Contouring Control for Milling, Drilling, and Boring Machines



The functions and specifications described in this brochure apply to the TNC 320 with NC SW 771851-06.

# Contents

The TNC 320...

Where can it be used?	Compact and versatile The right control for milling, drilling, and boring machines	4
What does it look like?	Intuitive and user-friendly The TNC 320 in dialog with the user Highly practical user interface	6
What can it do?	Minimize setup and non-machining time The TNC 320 makes setup easy The TNC 320 manages and measures	10
	Economical and productive Swivel head and rotary table controlled by the TNC Machine any contour slot with trochoidal milling	14
How is it programmed?	Programming, editing, and testing A full range of possibilities with the TNC 320 Graphical support in any scenario	16
	Programming in the shop Straightforward function keys for complex contours Free contour programming Practical cycles for recurring operations Reusing programmed contour elements Rapid availability of all information	18
	Open to outside information Processing CAD files with the TNC 320 Fast data transfer with the TNC Display any file formats on the TNC screen The TNC 320 programming station	24
What accessories are there?	Workpiece measurement Setup, preset setting, and measuring with touch trigger probes	29
	Tool measurement Measuring length, radius, and wear right on the machine	30
	Positioning with an electronic handwheel Fine motion control of axes	31
At a glance	Overview User functions Options Accessories Specifications	32

# **Compact and versatile**

The right control for milling, drilling, and boring machines

For more than 40 years, TNC controls from HEIDENHAIN have proven themselves every day on milling machines, machining centers, and drilling machines. Over this period, they have been continually further developed, with focus placed on an operating approach tailored to the needs of the machine operator.

These principles can also be found in the TNC 320: shop-oriented programmability with graphical support, many practical cycles, and an operational design that you are familiar with from other HEIDENHAIN controls.

#### **Shop-oriented programming**

You program conventional milling and drilling operations right at the machine, in Klartext—the dialog-guided, shop-oriented programming language from HEIDENHAIN. With helpful dialog guidance and informative visual aids, the TNC 320 provides optimal programming support.

For standard machining operations and even complex applications, a wealth of practical machining and coordinate transformation cycles are at your beck and call.

#### Easy to operate

When it comes to simple machining tasks, such as face milling, you don't need to write a program on the TNC 320. That's because it makes manual control equally easy—either by means of the axis keys or, for maximum sensitivity, with an electronic handwheel.

#### **Offline programming**

The TNC 320 is easy to program remotely as well. Its Ethernet interface ensures extremely short upload times, even for long programs.



# The TNC 320 is compact and easy to read.

The TNC 320 is a compact but versatile contouring control for three servo axes and servo spindle. Two further servo axes are an option. Thanks to its flexible operation shop-oriented programmability with HEIDENHAIN Klartext format or offline programming—and its scope of features, it is especially suited for use on universal milling, drilling, and boring machines for:

- Series and single-part production
- Tool making
- Machine building
- Research and development
- Prototypes and pilot plants
- Repair departments
- Training and education facilities

It also offers the applicable features both necessary and helpful for:

## Universal milling machines


- Free contour programming
- Milling cycles for complex contours
- Rapid preset setting with HEIDENHAIN touch probes


### **Drilling and boring machines**

- Drilling and boring cycles
- Cycles for circular and linear point patterns
- Drilling of oblique holes

### Machines with parallel secondary axes

- Compensation of movement in the secondary axes U, V, W through the principal axes X, Y, Z
- Defining the principal and secondary axes in the NC program enables execution on different machine configurations
- Movements of parallel axes included in the position display of the associated principal axis (sum display)

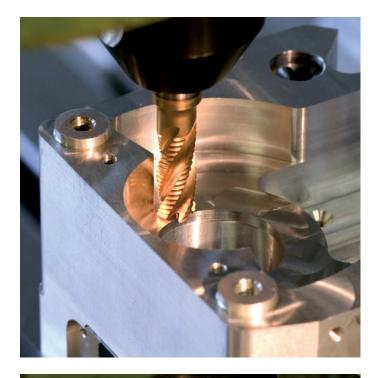

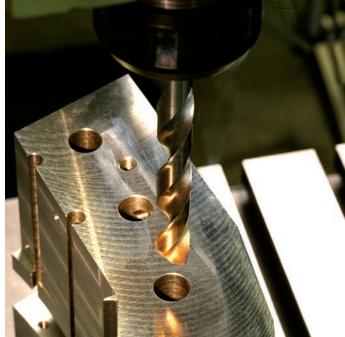

# Intuitive and user-friendly

The TNC 320 in dialog with the user

### The screen


In a clear format, the 15-inch screen displays all of the information you need for programming, operating, and checking the control and the machine, including program blocks, tips, and error messages. More information is provided through graphic support during program entry, test run, and actual machining.

You can also use a split screen to display your NC blocks on one side and the graphical image or the status display on the other.

While the program is running, status displays are available that inform you about the tool position, current program, coordinate transformations, and more. The TNC 320 even displays the current machining time.

### The operating panel

Like with all of the TNCs from HEIDENHAIN, the operating panel was designed with the programming process in mind. Program entry is aided by the thoughtful arrangement of keys into **function groups** for programming operating modes, machine operating modes, management/TNC functions, and navigation. Straightforward key assignment, readily understood symbols, and abbreviations unmistakably identify the various functions. With the **override potentiometers**, you can make fine adjustments to the feed rate and spindle speed.

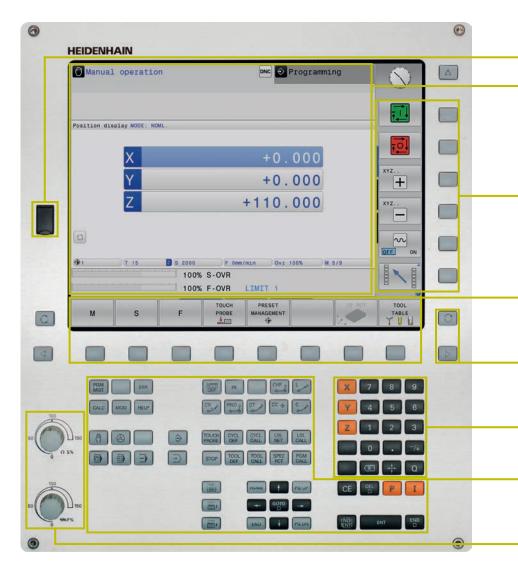

**USB port** for additional data storage or other pointing devices

**The screen content** includes two operating modes, the program, graphics, and the machine status

**PLC function keys** (soft keys) for machine functions

Self-explanatory **function keys** (soft keys) for NC programming

Keys for **screen management** (screen layout), operating mode, and switching between soft-key rows

Axis-selection keys and numeric keypad

**Function keys** for programming modes, machine operating modes, TNC functions, management, and navigation

**Override potentiometers** for feed rate and spindle speed

### Ergonomic and elegant, state-of-the-art

and field-proven—controls from HEIDENHAIN in a modern design. Judge for yourself:

#### Durable

The high-quality stainless-steel design of the TNC 320 features a special protective coating, making it particularly resistant to contamination and wear.

#### Smooth

The rectangular, slightly rounded keys are pleasant to the touch and reliable in operation. Their abrasion-resistant labeling can withstand extreme shop conditions.

### Versatile

Soft keys for both programming and machine functions always show only the currently available selections.

### Sensitive

With the handy control knobs, you can make fine adjustments to the feed rate and spindle speed.

### Communicative

The fast USB 2.0 interface lets you connect storage media or pointing devices to the operating panel simply and directly.

#### Flexible

The optional machine operating panel features easily exchangeable snap-on keys.

### Reliable

The elevated key bed of the machine operating panel (on versions with separate keyboard) prevents accidental actuation. LEDs serve for status display of each key by clearly indicating the active machine functions.













# Highly practical user interface

The key to safe and low-fatigue work is having an intuitive screen layout and an ergonomic, well-arranged keyboard. Although HEIDENHAIN has been adhering to these principles for a long time, the TNC 320 offers a number of features that make working with the control even simpler and easier than before.


#### Leading-edge design

The user interface of the TNC 320 boasts a sleek outer appearance with gently rounded edges, color gradients, and a pleasingly uniform font. The different screen areas are clearly delineated, and the operating modes are indicated by special operating mode symbols.

To help you evaluate the priority of error messages, the TNC 320 displays them in color-coded categories. A color-coded warning triangle is also displayed.

#### The smartSelect functions overview

With dialog support, you can now readily select functions that were previously available only via soft key structures. As soon as you open smartSelect, you are shown a tree structure with all of the subordinate functions that can be defined in the control's current operating state. The TNC also displays integrated help on the right-hand side of the smartSelect window. When you make a selection with the cursor or per mouse click, you immediately receive detailed information about the function. The smartSelect feature is also available for the definition of machining cycles, touch probe cycles, and special functions (SPEC FCT), and for parameter programming.

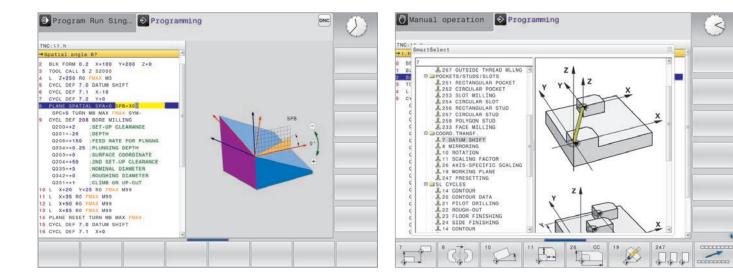

#### **Color-structured programs**

The content of a program line can be quite extensive:

- Line number
- Program function
- Input value
- Comment

To make sure you always keep an overview even in complex programs, the TNC 320 displays the individual program elements in different colors. This allows you, for example, to see at a glance where the editable input values are.

#### Universal table editor

Regardless of whether you are editing a tool, preset, or pallet table, the layout, method of operation, and functions of the table editor are always the same.

#### Info line


In the info line, the TNC 320 helps you orient yourself by displaying the respective status of the submode.


#### **MOD** function

The additional MOD operating mode offers a wide variety of possible settings in a standardized layout, regardless of the operating mode.

#### User administration

The user administration feature of the TNC 320 lets you define various roles and access rights for users, ensuring that each user can act only within his assigned rights. This prevents the unintentional or unauthorized deletion of files or content from system files. In addition, many functions are available only with the proper rights. Consequently, the user administration feature of the TNC 320 not only provides greater data security but also increases machine operating safety.

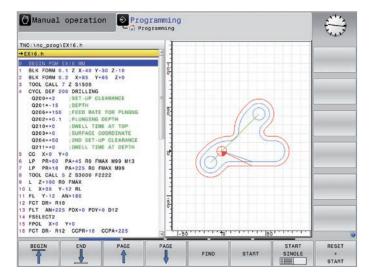

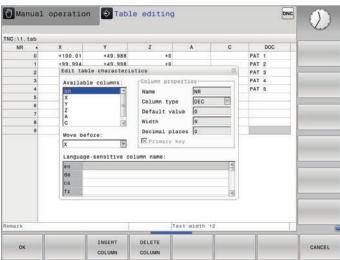

# Minimize setup and non-machining time

The TNC 320 makes setup easy

Before machining can begin, the workpiece must first be clamped, the machine must be set up, the position of the workpiece in the machine must be determined, and the preset must be set. Without support from the control, this is often a time-consuming but indispensable procedure because any error directly reduces the machining accuracy. Particularly in small and mediumsized production runs, as well as in the case of very large workpieces, setup times become a significant factor.

Here the TNC 320 shows its strengths: with its practice-oriented setup features it supports the operator and helps to reduce non-machining time. In conjunction with the **touch probes**, the TNC 320 offers numerous probing cycles for automatic workpiece setup, setting the preset, and measuring workpieces and tools.

## Fine manual axis control

During setup, you can use the axisdirection keys to move the machine axes manually or with an incremental jog. A simpler and more reliable way, however, is to use electronic handwheels from HEIDENHAIN (see page 31). With these handwheels, you are always close to the action, enjoy a close-up view of the setup process, and can control the infeed responsively and precisely.

### Adapting the probing speed

In many cases, the workpiece must be probed at unseen positions or in cramped spaces, and the standard probing feed rate is usually too fast for this. In such situations you can use the override potentiometer to change the feed rate during probing without affecting the accuracy.


## Workpiece alignment


Touch probes from HEIDENHAIN (see page 29) and the probing functions of the TNC 320 keep you from having to perform time-consuming workpiece alignment:


- You start by simply clamping the workpiece in any position.
- The touch probe then ascertains the actual workpiece position by probing a surface, two holes, or two studs.
- The TNC 320 subsequently compensates for the misalignment by performing a "basic rotation," in which either the NC program is executed at the ascertained angle of rotation or the rotary table is turned in order to correct the misalignment.
- The TNC 320 offers manual, automatic, and semiautomatic cycles for compensating for misalignments in two or three dimensions

## Compensating for workpiece misalignment

by rotating the coordinate system or turning the table

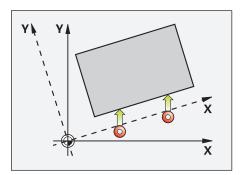

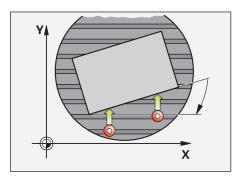

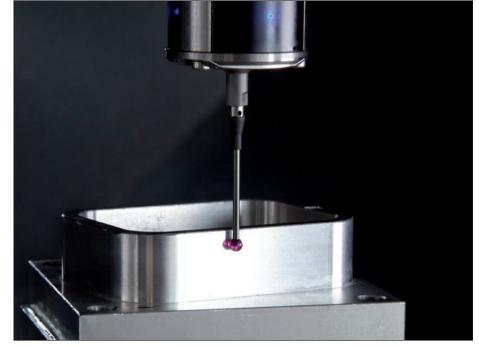

### Setting presets

A preset allows you to assign a defined value displayed by the TNC to any position on the workpiece. Finding this point quickly and reliably reduces non-productive time and increases machining accuracy.

The TNC 320 features probing cycles for automatically setting presets. Ascertained presets can be saved as follows:

- Using the preset management
- In a datum table
- Through direct setting of the display

# Preset management with the preset table

Preset management enables flexible machining, shorter setup times, and higher throughput. Setting up your machine is greatly simplified.

In preset management, you can save **any number of presets** and assign an individual basic rotation to each one. In order to permanently save fixed presets in the machine's workspace, you can also write-protect individual lines.

There are three possibilities for rapidly saving the presets:

- Via a soft key in Manual mode
- Via the probing functions
- With the automatic probing cycles


### Saving datums


Datum tables let you save positions or measured values from the workpiece. Datums are always defined relative to the active preset.

				_		- Venter
NO +	DOC	x	Y	z	SPC	SPB
٥		+0	+0	+0	+0	M
1		+0	+0	+300	+0	
2		+0	+0	+0	+0	
3		+0	+ 0	+0	+0	Carl In
4		+0	+ 0	+ 0	+0	S
5		+0	+0	+ 0	+0	
6		+ 0	+ 0	+ 0	+0	
7		+0	+ 0	+0	+0	TO
8		+0	+0	+0	+0	
9		+0	+ 0	+0	+0	¥.
<] DOC	Text width	m				
	Lexr MIDEN	0		TNC:\table\p	reset.pr	<b>a</b>
	Text width	100% S-			reset.pr	
	X	100% S-	OVR LI	MIT 1 +0.000	reset.pr	\$100%
		100% S-	OVR LI	MIT 1	reset.pr	S100%
		100% S- 100% F- -17.813 B	OVR LI	MIT 1 +0.000	reset.pr	S100%
	X Y Z Mode: NOML.	100% S- 100% F- -17.813 B +72.846 C -5.000	OVR LI	MIT 1 +0.000 +0.000	reset.pr	\$100%
	X Y Z	100% S- 100% F- -17.813 B +72.846 C -5.000	OVR LI	MIT 1 +0.000 +0.000		\$100% (©) () () () () () () () () () () () () ()

### Setting a preset

on a corner, for example, or in the center of a circular stud

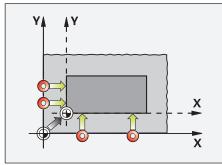

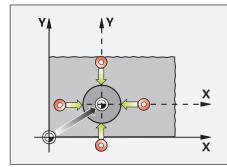


# The TNC 320 manages and measures

The requirements gap between machining centers and typical tool and moldmaking machines is becoming ever narrower. Of course, the TNC 320 is also very capable of controlling automated manufacturing processes. It features the necessary functionality to manage and measure tools, as well as to inspect the machining process. It helps you reduce non-machining time, increase productivity, and improve production quality.


# Inspecting workpieces for proper machining and dimensional accuracy

The TNC 320 features a number of measuring cycles for checking the geometry of the machined workpieces. This requires inserting a touch probe from HEIDENHAIN (see page 29) into the spindle in place of the tool. The resulting functionality allows you to do the following:


- Recognize a workpiece and call the appropriate part program
- Check whether all machining operations
   were conducted correctly
- Determine infeeds for finishing
- Detect and compensate for tool wear
- Ascertain the machining error trend
- Log measured data
- Check whether tolerances were maintained, and configure various reactions, such as an error message

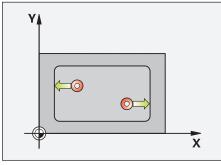

Measuring length

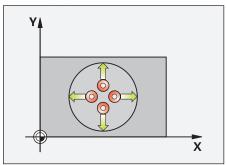

Measuring a circular pocket/hole

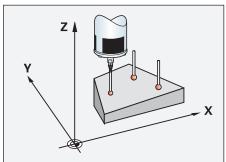


Measuring the angle of a plane




# Tool measurement and automatic compensation of tool data

In conjunction with the TT touch probes (see page 30), the TNC 320 can automatically measure tools while they are in the machine. The TNC 320 then stores the determined values, such as tool length and radius, in its tool memory. In-process tool measurement allows you to immediately identify wear or breakage, thus avoiding scrap and rework. If the measured deviations lie outside the specified tolerances or if the monitored tool life has been exceeded, the TNC 320 locks the tool and automatically inserts a replacement tool.

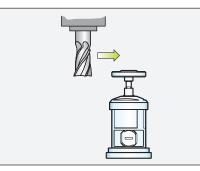

Measuring the tool radius

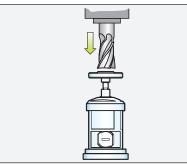

Measuring the tool length



Measuring tool wear

### **Tool management**

For machining centers with an automatic tool changer, the TNC 320 offers a central tool management function for any number of tools. This tool management function is a freely configurable file that can be optimally adapted to your needs. You can even have the TNC 320 manage your tool names. The control prepares the next tool change while the current tool is still cutting. This significantly reduces the non-cutting time required for tool changes.

With the Extended Tool Management option, you can also graphically prepare and display any data.\*

\* The machine must be adapted for this function by the machine manufacturer.





# **Economical and productive**

Swivel head or rotary table controlled by the TNC (option)

Many five-axis operations that initially appear to be highly complex can be broken down into common 2-D movements that have been tilted about one or more rotary axes or wrapped around a cylindrical surface. For creating and editing these programs quickly and easily without a CAD/CAM system, the TNC comes to your aid with helpful functions.

### Tilting the working plane\*

Programs for contours and holes on inclined surfaces are usually very complex, requiring significant computing resources and programming work. But the TNC 320 can save you a great deal of programming time.

You simply program the machining operation as usual in the main plane (e.g., in XY). The machine then runs the program in a plane that has been tilted with respect to the main plane about one or more rotary axes. The PLANE function makes it easy for you to define a tilted working plane: tilted working planes can be specified in seven different ways depending on the information available in the workpiece drawing. Help images support you during program entry.

You can also use the PLANE function to define the positioning behavior during tilting to avoid unpleasant surprises when the program is run. The settings for defining the positioning behavior are identical for all PLANE functions, making operation much easier.

### Cylinder surface machining\*

Programming contours made up of straight lines and circles on cylindrical surfaces for rotary tables is no problem with the TNC 320. You simply program the contour in the plane of an unrolled cylinder surface. The TNC 320 then performs the machining operation on the cylindrical surface of the cylinder.

The TNC 320 features four cycles for cylindrical surface machining:

- Slot milling (the slot width is the same as the tool diameter)
- Guide-groove milling (the slot width is greater than the tool diameter)
- Ridge milling
- Outside contour milling
- \* The machine must be adapted for this function by the machine manufacturer.






# Machine any contour slot with trochoidal milling

The ability to machine any slot at high efficiency from start to finish is the key benefit of trochoidal milling. In trochoidal milling, roughing is performed with forward linear motion superimposed onto circular strokes. It is often used on high-strength or hardened materials that would otherwise require low infeeds due to the high loads on both tool and machine. Thanks to the special cutting motion used in trochoidal milling, however, there are no added wear-inducing influences on the tool, and higher infeeds are possible. During hobbing, the entire cutting edge can be used as well. You thereby attain a higher material removal rate per tooth. Circularmotion plunging into the material exerts less radial force on the tool. This reduces the mechanical load on the machine and prevents vibration. The slot to be machined is described in a contour subprogram as a contour train. You define the dimensions of the slot and the cutting data in a separate cycle. Any residual material can then be easily removed with a subsequent finishing cut.

The main benefits are as follows:

- Contact over entire cutter length
- Higher material removal rates
- Less strain on the machine
- Less vibration
- Integrated finishing of the side wall



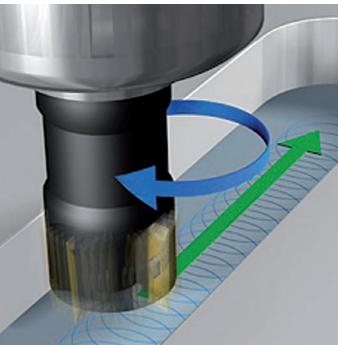

# Programming, editing, testing

A full range of possibilities with the TNC 320

Besides being universally deployable, the TNC 320 is equally flexible when it comes to programming and machining.

### Positioning with Manual Data Input

You don't need to create a complete program in order to start machining with the TNC 320. You can machine a workpiece step by step using both manual machining and automatic positioning in any sequence.

### Programming at the machine

HEIDENHAIN controls are designed for shop-friendly programming right at the machine. Instead of requiring you to know G-codes, the **Klartext conversational programming language** provides its own buttons and soft keys for programming straight lines, arcs, and cycles. At the push of a button, HEIDENHAIN Klartext dialog guidance opens and actively helps you during programming on the TNC. Unambiguous questions and prompts help you enter all the required information.

And even if you prefer **ISO programming**, the TNC 320 is still the right control: it displays soft-key rows dedicated to the most important ISO commands so that you can enter ISO programs directly. Or you connect a USB keyboard and use it to write the program.

All interface texts, including Klartext tips, dialog prompting, program steps, and soft keys, are available in numerous languages.

### **Creating programs offline**

The TNC 320 is also well equipped to handle offline programming. Its interfaces allow the control to be integrated into networks in order to connect with programming stations or other data storage media. The TNC 320 can also run programs that were written in ISO format.







# Graphical support in any scenario

### **Programming graphics**

The two-dimensional programming graphics give you additional assurance: while you are programming, the TNC 320 renders every programmed movement on the screen. You can opt for a plan view, side view, or front view. Tool paths or rapidtraverse movements can be hidden, and the image's scale can be changed.

### **Program verification graphics**


For added certainty prior to machining, the TNC 320 can simulate and render the machining of the workpiece at high resolution. This simulation can be viewed in different formats:


- Plan view at different levels of depth
- Three projections
- 3-D view


The 3-D view lets you display the programmed tool-center path in three dimensions, and a powerful zoom function lets you see even the tiniest details. The 3-D line graphics are especially helpful in verifying programs created offline, allowing you to avoid undesired machining marks on the workpiece, such as those that occur when the postprocessor outputs points incorrectly. In 3-D view, the TNC also includes a measuring function that displays the coordinates of wherever your mouse happens to be within the graphics.

### **Program-run graphics**

The program-run graphics display the workpiece in real time in order to show you the machining progress. Direct observation of the workpiece is usually impossible due to coolant and the safety enclosure. During machining, you can switch between various operating modes at any time in order to create programs, for example. And at the press of a button, you can cast a glance at the machining progress while programming.

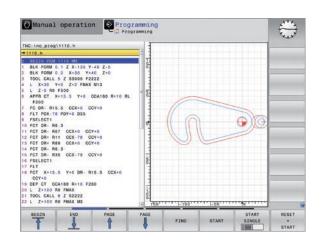

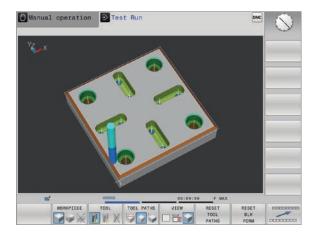

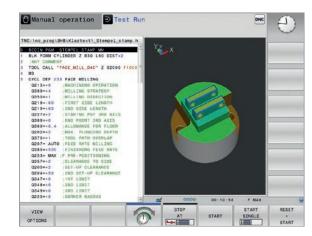

# **Programming in the shop**

Straightforward function keys for complex contours

# **Programming 2-D contours**

Two-dimensional contours are the bread and butter of a modern machine shop, which is why the TNC 320 offers a variety of ways to handle them.

### Programming with function keys


Are the contours properly dimensioned for NC machining? In other words, are the end points of the contour elements provided in either Cartesian or polar coordinates? If yes, then you can create the NC program straightaway using function keys.

#### Straight lines and circular elements

To program a line segment, for example, simply press the linear traverse key. The Klartext conversational programming language of the TNC 320 then prompts you for all of the information needed by the programming block, including the target coordinates, feed rate, tool compensation value, and machine functions. Function keys for circular movements, chamfers, and corner rounding also simplify your programming work. In order to avoid surface blemishes during approach or departure from the contour, movement must be seamless-that is, tangential.

You simply specify the starting point or end point of the contour and the approach or departure radius of the tool. The control handles the rest.

The TNC 320 can foresee a contour with radius compensation by up to 99 blocks, thus taking back-cutting into account and avoiding contour gouging. This could be the case, for example, when roughing a contour with a large tool.

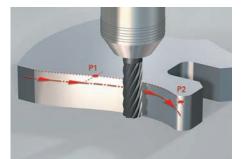




Circular path with seamless (tangential) transition from the preceding contour element, defined by its end point

by its center, end


direction

point, and rotational

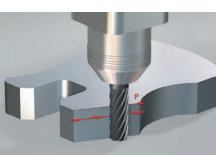




Circular path defined

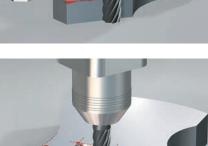



Chamfer defined by the corner point and chamfer length

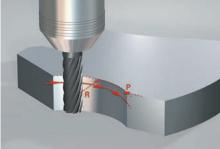




Circular path defined by its radius, end point, and rotational direction





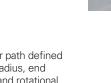

# Free contour programming



# Extensive machining cycles for milling and drilling

Frequently recurring operations consisting of multiple machining steps are stored as cycles in the TNC 320. Dialog guidance and help graphics illustrating the required input parameters support you in programming them.

### Standard cycles


In addition to drilling and tapping cycles (with or without a floating tap holder), a variety of selectable cycles are available:

- Thread milling and reaming
- Engraving and boring
- Hole patterns
- Milling cycles for face milling a flat surface
- Roughing and finishing of pockets, slots, and studs

## Cycles for complex contours

Of great help in roughing pockets with any contour are the control's **SL cycles** (SL = Subcontour List). This term refers to machining cycles for pilot drilling, roughing, and finishing in which the contour or subcontours are defined in subprograms. Thus, a single contour description can be used for more than one operation with different tools.

Up to twelve **subcontours** can be superimposed for the machining operation. The control automatically calculates the resulting contour and the tool paths for roughing or clearing the surfaces. Subcontours can be pockets or islands. Multiple pockets are combined to form a single pocket, with the tool bypassing any islands. During roughing, a **finishing allowance** on the wall and floor surfaces is also taken into account by the TNC 320. When **roughing** with different tools, the control identifies residual material to be removed by smaller tools. A separate cycle is used for finishing to the final dimensions.

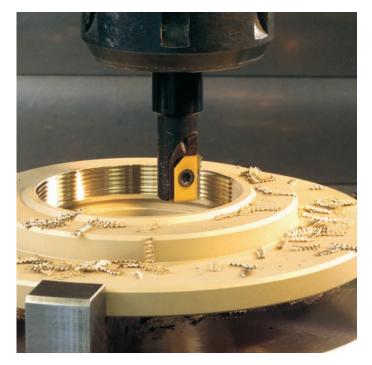



#### **OEM cycles**


Machine manufacturers can incorporate their specialized production expertise in the form of additional machining cycles and store them in the TNC 320. The end user can write his own cycles as well. HEIDENHAIN provides help in programming these cycles with its CycleDesign PC software, which allows you to create input parameters and arrange the TNC 320's soft key structure as desired.

# Program machining patterns with ease and flexibility

Positions to be machined are often arranged in patterns on the workpiece. The TNC 320's graphical support helps you program a wide range of machining patterns with ease and exceptional flexibility. You can define as many point patterns as desired with various numbers of points. During machining, you can then have all of the points executed as a unit, or each point individually.

# 3-D machining with parametric programming

Simple, mathematically easy-to-describe 3-D geometries can be programmed by means of parametric programming. At your disposal are basic arithmetical operations, trigonometric functions, roots, powers, logarithmic functions, parentheses, and logical comparisons with conditional jump instructions. Parametric programming also gives you a simple way to implement 3-D operations. Of course, parametric programming is also well-suited for **2-D contours** that cannot be described with lines or circular arcs but rather through mathematical functions.

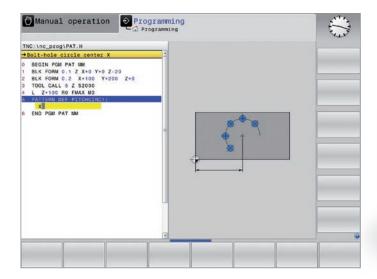



# Reusing programmed contour elements

#### **Coordinate transformations**

If you need a pre-programmed contour at different locations and in different sizes on the workpiece, then the TNC 320 offers you a convenient solution in the form of coordinate transformations. With coordinate transformation you can, for example, **rotate or mirror** the coordinate system, or **shift the datum**. With a **scaling factor** you can enlarge or reduce contours to respect shrinkage or oversizes.

# Program-section repeats and subprograms

Many machining operations repeat themselves either on the same workpiece or on different workpieces. Once you have programmed a detail, there is no need to program it again. With its subprogram technology, the TNC can save you a great deal of programming time.

In **program-section repeats**, you can label a section of the program, and the TNC will repeat this section as many times as required.

You can mark a program section as a **subprogram** and then call it at any point in the program and as often as you want.

With the **program call** function, you can even use a completely separate program at any location in your current program. This allows you to leverage already programmed and frequently required working steps or contours.

Of course you can also combine these programming techniques.





# Rapid availability of all information

Do you have questions about a programming step but your User's Manual is not at hand? No problem: both the TNC 320 control and the TNC 320 programming station feature TNCguide, a convenient help system that displays the user documentation in a separate window.


You can activate TNCguide simply by pressing the HELP key on the TNC keyboard or by clicking any soft key when the mouse pointer has switched to a question mark. This is easily done by clicking on the help icon permanently displayed on the TNC screen.


TNCguide generally displays the information instantaneously and in the correct context (context-sensitive help), immediately giving you the information you currently need. This function is particularly helpful for soft keys and provides a detailed explanation of their effects.

You can download the documentation in the desired language free of charge from the HEIDENHAIN website and save it to the appropriate language directory of the TNC hard disk.

The following user's manuals are available in the help system:

- Klartext Conversational Programming
- Setup, Testing, and Running NC Programs
- Cycle Programming
- ISO Programming
- TNC 640 Programming Station (installed only with the programming station)

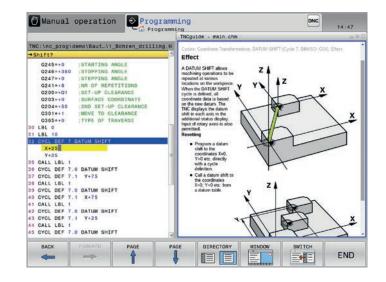

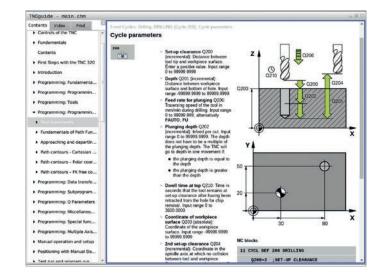

# **Open to outside information**

Processing CAD files with the TNC 320 (option)

#### **CAD** viewer

With the standardly available CAD viewer software, you can open 3-D CAD models and drawings directly on the TNC 320. Various view options as well as rotation and zoom capabilities allow for a detailed visual inspection and analysis of your CAD data. You can also use the viewer to ascertain position values from a 3-D model. You simply select an arbitrary reference point in your drawing and select the desired contour elements. The CAD viewer then displays the coordinates of the elements in a window. The CAD viewer can depict the following file formats:

- STEP files (.STP and .STEP)
- IGES files (.IGS and .IGES)
- DXF files (.DXF)

#### CAD Import (option)

Why program complex contours if you already have the drawing as a DXF, STEP, or IGES file? After all, you have the ability to extract contours or machining positions from these types of CAD files. This not only saves time otherwise spent on programming and testing, but you can also be sure that the finished contour is exactly in accordance with the design engineer's specifications.

Extracting machining information directly from CAD data offers additional possibilities, particularly for the creation of NC programs with a tilted machining plane. You can also define the preset with a 3-D basic rotation of the 3-D model and set a datum with the appropriate 3-D rotation in the desired working plane. You can easily save the working plane to the clipboard and transfer it to the NC program with the appropriate transformation and the associated PLANE command. In the defined working plane, you can extract contours and machining positions, and apply them to the NC program.


Selecting the contour is particularly convenient. You first select any element by clicking it with the mouse. As soon as you have selected a second element, the TNC 320 detects your desired machining direction and initiates automatic contour detection. The TNC 320 automatically selects all clearly identifiable contour elements until the contour closes or branches out. In this manner, you can define extensive contours with just a few mouse clicks. Then you can simply copy the selected contour to an existing Klartext program using the clipboard.




You can also select **machining positions** and save them as point files, especially in order to apply hole positions or starting points for pocket machining. This can be done very easily by selecting the desired area with the mouse. In a pop-up window with a filter function, the TNC 320 displays all of the hole diameters within the area you have selected. To select the desired hole diameters and restrict the number of hole positions, simply click the corresponding filter symbol to change the filter limits. A zoom function and various configuration possibilities round out the functionality of CAD Import. It is also possible to define the contour program's resolution for using it in older TNC controls. You can also define a transition tolerance if the contour elements are not completely connected. The following positions can be defined as presets:

- The beginning, end, or mid-point of a line
- The beginning, end, or center point of a circular arc
- Quadrant transitions or center point of a circle
- Intersection of two lines, regardless of their extension
- Intersection of a line and a circular arc
- Intersection of a line and a circle

If multiple intersections between two elements are possible (e.g., between a straight line and a circle), then you can select the correct intersection with a mouse click.

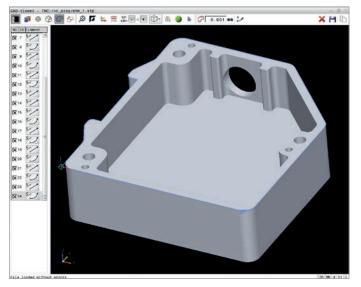

Contour selection from an imported CAD file

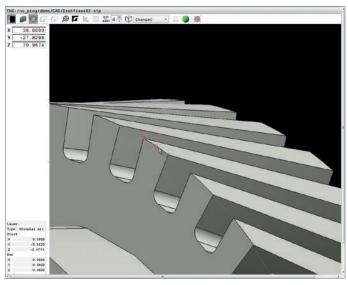

Display of a 3-D model in the CAD viewer


# Fast data transfer with the TNC

### The networked TNC 320

You can integrate the TNC 320 into networks and connect it to PCs, programming stations, and other data storage media. Even the basic version of the TNC 320 is equipped with a latestgeneration Fast Ethernet data interface in addition to its RS-232-C/V.24 data interface. The TNC 320 uses the TCP/IP protocol to communicate with NFS servers and Windows networks without requiring additional software. The fast data transfer at rates of up to 1000 Mbit/s ensures very short transmission times.

The transmitted programs are saved in the TNC 320's internal memory and are run from it at high speed.

For well-organized program management on your control, simply place the individual files in directories (folders). You can structure the respective directories through individual subdirectories.

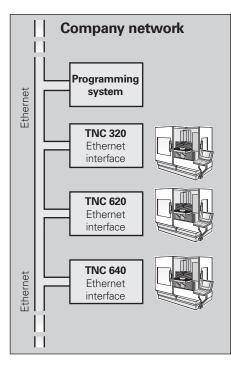

#### Programs for data transfer

With the aid of the free PC software **TNCremo** from HEIDENHAIN, you can do the following:

- Transfer remotely stored part programs and tool or pallet tables in both directions
- Make backups.

With the powerful **TNCremoPlus** PC software, you can also transfer the screen contents of the control to your PC using the live-screen function.



# Display any file formats on the TNC screen


#### **PDF viewer**


The integrated PDF viewer can open PDF files right on the control, making it easy for you to view work instructions, drawings, or other information on the TNC.

The integrated browser lets you connect the TNC to the Internet and access it directly from the control. You can also open the following further file formats right on the TNC using the appropriate programs, and even edit some of them:

- Text files ending in .txt or .ini
- Graphic files ending in .gif, .bmp, .jpg, .png
- Table files ending in .xls or .csv
- HTML files

An operating panel with integrated touchpad or an external USB pointing device is required for operation.

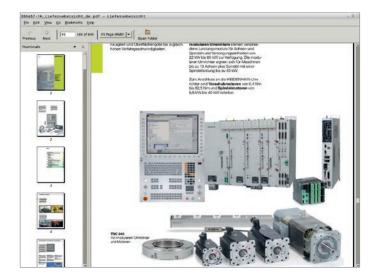

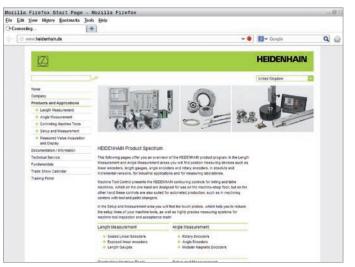

# The TNC 320 programming station

#### Why a programming station?

As easy as it is to write a part program on a TNC 320 at the machine while a different part is being machined, short reloading times or high machine utilization may hinder attentive programming work on the shop floor. The TNC 320 programming station lets you program exactly as you would at the machine, but away from all the noise and distractions of the shop.

#### **Creating programs**

The programming, testing, and optimizing of HEIDENHAIN Klartext or G-code programs for the TNC 320 with the programming station substantially reduces machine idle times. And it's easy to get used to because every keystroke feels the same: the programming station's keyboard is just like the one on the machine.

### Testing programs created offline

Naturally, you can also test programs that were written on a CAD/CAM system. The various views of the program verification graphics help you reliably spot contour damage and hidden details.

# Training with the TNC 320 programming station

Because the TNC 320 programming station is based on the same software as the TNC 320 control, it is ideally suited for apprentice- and advanced-level training. Programming and Test Run modes work exactly as they would on the machine. This gives the trainee the confidence needed to operate a real machine.

By being programmable in either Klartext or ISO, the TNC 320 programming station is also well suited for TNC programming training in school settings.

More information about the programming station and a free demo version are available on the Internet at *www.heidenhain.de.* Or simply ask for the *Programming Stations for TNC Controls* CD or brochure.

#### Your workstation

The programming station software runs on a PC. The PC screen shows you the same TNC user interface as the control and offers the familiar graphical support. Depending on the version of the programming station, there are multiple ways of using it.

The free **demo version** contains all of the TNC 320's functions and allows short programs to be saved. Programming is performed on the PC keyboard.

The version with a **TNC operating panel** lets you create programs in the accustomed manner on a keyboard featuring the same function keys as the control on the machine. It also has a PC keyboard for ISO programming, file names, and comments.

You can also work without the TNC operating panel: a **virtual keyboard** for operating the programming station is shown on the PC screen. This virtual keyboard provides the TNC 320's most important dialog-opening keys.



Programming station with TNC operating panel

# Workpiece measurement

# Setup, preset setting, and measuring with touch trigger probes

Workpiece touch probes\* from HEIDENHAIN help you keep costs down in the shop and in serial production: when used in conjunction with the TNC 320's probing cycles, they enable the automated execution of setup, measurement, and inspection functions.

Upon contact with the workpiece surface, the stylus of a TS touch trigger probe is deflected. In that instant, the TS generates a triggering signal that, depending on the model, is transmitted either by cable or an infrared beam to the control.

The touch probes\* are inserted directly into the machine tool spindle and can be equipped with various taper shanks depending on the machine. The ball tips, which are made of ruby, are available in different diameters and stylus lengths.

\* The machine and TNC must be specially adapted by the machine manufacturer.



### Cable-bound touch probes

For machines requiring manual tool changes, as well as for grinding machines and lathes:

### TS 260

- New generation
- Axial or radial cable connection

### Wireless touch probes

For machines with an automatic tool changer:

## TS 460

- Standard, latest-generation touch probe for radio and infrared transmission
- Compact dimensions
- Energy-saving mode
- Optional collision protection
- Thermal decoupling

# TS 642

- Activation via switch in taper shank
- Infrared transmission

### TS 740

- High scanning accuracy
- High reproducibility
- Low probing forces
- Infrared transmission

#### Transceiver unit

Radio or infrared transmission is established between the TS or TT touch probe and the SE transceiver:

#### SE 660

- For radio or infrared transmission (hybrid technology)
- Same SE for TS 460 and TT 460


#### SE 661

- For radio or infrared transmission (hybrid technology)
- Same SE for TS 460 and TT 460
- EnDat functionality for transmission of the switching state, diagnostics, and additional information





TS 460 with collision protection

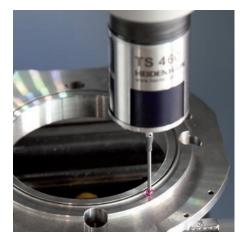



Detailed descriptions of workpiece touch probes are available on the Internet at *www.tastsysteme.de* or in the *Touch Probes* brochure.

# **Tool measurement**

Measuring length, radius, and wear inside the machine

A key factor in obtaining consistently high production quality is, of course, the tool itself. This requires exact measurement of the tool dimensions and periodic inspection of the tool for breakage, wear, and tooth shape. For tool measurement, HEIDENHAIN offers the TT triggering tool touch probes.

These touch probes are installed directly within the machine's workspace, where they enable tool measurement either before machining or during interruptions. The **TT tool touch probes** measure the tool length and radius. During probing of the rotating or stationary tool, such as for individual tooth measurement, the contact plate is deflected and a trigger signal is transmitted directly to the TNC 320.

The **TT 160** uses cable-bound signal transmission, whereas the **TT 460** sends its signals via radio or infrared transmission. It is thus particularly well suited for use on rotary/tilting tables.

To avoid collisions or prevent limiting the machining space, the TT should be removed from the machine for the duration of machining. Among other actions, the TT must then be reoriented before it can be used again. The new base features three contact points and a setting screw. As a result, the touch probe requires calibration only during initial installation. A magnetic base has proved ideal for compact installation on rotary tables. Additionally, the TT can be re-installed and removed with a quick hand movement. Here are the benefits in a nutshell:

- Fast re-installation without recalibration
- Low-profile base
- Same accuracy as a permanent installation



TT 460



Detailed descriptions of tool touch probes are available on the Internet at *www.tastsysteme.de* or in the *Touch Probes* brochure.



# Positioning with an electronic handwheel

Fine motion control of axes

You can set up the workpiece by manually jogging the axes with the axis direction keys, but this task is easier and more finely controllable with the electronic handwheels from HEIDENHAIN.

In this method, the axis slides are moved by the feed motor in accordance with the handwheel's rotation. For particularly high sensitivity, you can incrementally set the amount of traversing distance for each handwheel rotation.

## Panel-mounted handwheels

The HR 130 and HR 150 panel-mounted handwheels from HEIDENHAIN can be integrated into the machine operating panel or mounted to a different part of the machine. An adapter permits connection of up to three HR 150 electronic panel-mounted handwheels.

### Portable handwheels

The HR 510, HR 520, and HR 550 portable handwheels are particularly helpful when you work in close proximity to the machine's workspace. The axis keys and certain function keys are integrated into the housing. In this way, you can switch axes and set up the machine at any time-regardless of where you happen to be standing. The HR 520 and HR 550 handwheels feature an integrated display for user-friendly remote operation of the control. As a wireless handwheel, the HR 550 is ideal for use on large machines. If you no longer need the handwheel, simply attach it to the machine using its built-in magnets.

# Expanded range of functions of the HR 520 and HR 550

- Definable traversing distance per revolution
- Display for operating mode, actual position value, programmed feed rate, spindle speed, and error messages
- Override potentiometers for feed rate and spindle speed
- Handwheel offset
- Selection of axes by means of keys and soft keys
- Keys for continuous traverse of the axes
- Emergency stop button
- Actual position capture
- NC start/stop
- Spindle on/off
- Soft keys for machine functions to be defined by the machine manufacturer





# **Overview** User functions

User functions	ard		
	Standard	Option	
Short description	<ul> <li>✓</li> </ul>		Basic version: 3 axes plus closed-loop spindle
		0	1st additional axis for 4 axes plus open-loop or closed-loop spindle 2nd additional axis for 5 axes plus open-loop or closed-loop spindle
Program entry	✓ ✓		HEIDENHAIN Klartext conversational programming language ISO programming via soft keys or USB keyboard
Position entry	✓ ✓ ✓		Nominal positions for straight lines and arcs in Cartesian coordinates or polar coordinates Incremental or absolute dimensions Display and entry in mm or inches
Tool compensation	✓ ✓		Tool radius in the working plane and tool length Radius compensated contour look ahead for up to 99 blocks (M120)
Tool tables	~		Multiple tool tables with any number of tools
Cutting data	~		Automatic calculation of spindle speed, cutting speed, feed per tooth, and feed per revolution
Constant contour speed	$\checkmark$		Relative to the path of the tool center point Relative to the tool's cutting edge
Parallel operation	~		Program creation with graphical support while another program is running
Rotary table machining		8 8	Programming of contours for machining on a cylinder as if in two axes Feed rate in mm/min
Contour elements	✓ ✓ ✓ ✓		Straight line Chamfer Circular path Circle center
	✓ ✓ ✓		Circle radius Tangentially connecting circular arc Corner rounding
Contour approach and departure	✓ ✓		Via straight line: tangential or perpendicular Via circular arc
FK free contour programming	~		FK free contour programming in the HEIDENHAIN Klartext conversational programming language with graphical support for workpiece drawings not dimensioned for NC
Program jumps	✓ ✓ ✓		Subprograms Program-section repeats Any program as a subprogram
Fixed cycles	* * * * * * * * * *		Cycles for drilling, peck drilling, reaming, boring, counterboring, conventional and rigid tapping Cycles for milling internal and external threads Rectangular and circular pockets Face milling Cycles for clearing level and inclined surfaces Multi-operation machining of straight and circular slots Multi-operation machining of rectangular and circular pockets Circular and linear point patterns Contour train, contour-parallel contour pocket OEM cycles (special cycles developed by the machine manufacturer) can be integrated Engraving cycle: engraving of text or numbers in a straight line or on an arc

User functions			
	Standard	no	
	Star	Option	
Coordinate transformations	~	8	Shifting, rotating, mirroring, scaling (axis-specific) Tilting the working plane, PLANE function
<b>Q parameters</b> Programming with variables			Mathematical functions =, +, -, *, /, sin $\alpha$ , cos $\alpha$ , tan $\alpha$ , arc sin, arc cos, arc tan, a <sup>n</sup> , e <sup>n</sup> , ln, log, $\sqrt{a}, \sqrt{a^2 + b^2}$ Logical operations (=, = /, <, >) Calculating with parentheses Absolute value of a number, constant $\pi$ , negation, truncation of digits before or after the decimal point Functions for calculation of circles Functions for text processing
Programming aids	$\begin{array}{c} \checkmark \\ \checkmark $		Calculator Complete list of all current error messages Context-sensitive help function for error messages TNCguide: the integrated help system; user information available directly on the TNC 320 Graphical support for the programming of cycles Comment and structure blocks in the NC program
Teach-in	$\checkmark$		Application of actual positions directly in the NC program
<b>Program verification</b> graphics Display modes	✓ ✓ ✓		Graphical simulation of the machining operation, even while another program is being executed Plan view / projection in three planes / 3-D view, also in tilted working plane / 3-D line graphics Detail zoom
Programming graphics	~		Rendering (2-D pencil trace graphics) of entered NC blocks in Programming and Editing mode, even while another program is being executed
<b>Program-run graphics</b> Display modes	$\checkmark$		Real-time graphical simulation during execution of the program Plan view / view in three planes / 3-D view
Machining time	$\checkmark$		Calculation of machining time in the Test Run operating mode Display of the current machining time in the Program Run operating modes
Returning to the contour	✓ ✓		Mid-program startup at any block in the program and movement to the calculated nominal position for continuation of the machining operation Program interruption, contour departure, and return
Preset management	~		For storing any presets
Datum tables	~		Multiple datum tables for storing workpiece-specific datums
Touch probe cycles	✓ ✓ ✓ ✓		Touch probe calibration Compensation of workpiece misalignment Manual or automatic preset setting Automatic tool and workpiece measurement
Parallel secondary axes	✓ ✓ ✓		Compensation of movement in the secondary axes U, V, W through the principal axes X, Y, Z Movements of parallel axes included in the position display of the associated principal axis (sum display) Defining the principal and secondary axes in the NC program enables execution on different machine configurations
Conversational languages	~		English, German, Czech, French, Italian, Spanish, Portuguese, Swedish, Danish, Finnish, Dutch, Polish, Hungarian, Russian (Cyrillic), Chinese (traditional, simplified), Slovenian, Slovak, Norwegian, Korean, Turkish, Romanian
CAD viewer	$\checkmark$		Display of CAD models on the TNC

# Options Accessories

Option number	Option	With NC software 771851- or later	ID	Comment
0 1	Additional Axis	01	354540-01 353904-01	<ul><li>Additional control loop 1</li><li>Additional control loop 2</li></ul>
8	Advanced Function Set 1	01	536164-01	<ul> <li>Rotary table machining</li> <li>Programming of contours for machining on a cylinder as if in two axes</li> <li>Feed rate in mm/min</li> </ul>
		01		Interpolation <ul> <li>Circular in three axes with tilted working plane</li> <li>Coordinate transformation</li> <li>Tilting the working plane</li> <li>PLANE function</li> </ul>
18	HEIDENHAIN DNC	01	526451-01	Communication with external PC applications over COM component
42	CAD Import	01	526450-01	Import of contours from 3-D models
93	Extended Tool Management	02	676938-01	Extended tool management for more information
133	Remote Desktop Manager	01	894423-01	Display and remote operation of external computer units (e.g., a Windows PC)
137	State Reporting Interface	07	1232242-01	Obtaining operating states

Accessories	
Electronic handwheels	<ul> <li>HR 510: portable handwheel, or</li> <li>HR 520: portable handwheel, or</li> <li>HR 550: portable wireless handwheel, or</li> <li>HR 130: panel-mounted handwheel</li> </ul>
Workpiece measurement	<ul> <li>TS 260: touch trigger probe with cable connection, or</li> <li>TS 248: workpiece touch probe with reduced deflection force, or</li> <li>TS 460: touch trigger probe with radio or infrared transmission, or</li> <li>TS 642: workpiece touch probe with infrared transmission, or</li> <li>TS 740: touch trigger probe with infrared transmission</li> </ul>
Tool measurement	<ul> <li>TT 160: 3-D touch trigger probe, or</li> <li>TT 460: 3-D touch trigger probe with radio or infrared transmission</li> </ul>
Software for PCs	<ul> <li>TeleService: software for remote diagnostics, monitoring, and operation</li> <li>CycleDesign: software for creating your own cycle structure</li> <li>TNCremo: software for data transfer—free of charge</li> <li>TNCremoPlus: software for data transfer with live-screen function</li> </ul>
Programming station	Control software for PCs for programming, archiving, and training • Single-station license with original control operating panel • Single-station license with operation via virtual keyboard • Network license with operation via virtual keyboard • Demo version (operated with virtual keyboard or PC keyboard—free of charge)

# Specifications

Specifications	
Components	Main computer with TNC keyboard and integrated 15-inch screen with soft keys
Operating system	HEROS 5 real-time operating system for machine control
Memory	<ul> <li>RAM memory: 2 GB</li> <li>NC program memory: 1.8 GB (on CFR Compact Flash memory card)</li> </ul>
Input resolution and display step	<ul> <li>Linear axes: down to 0.1 μm</li> <li>Rotary axes: down to 0.0001°</li> </ul>
Input range	• Maximum 99 999 999 mm or 99 999 999°
Interpolation	<ul> <li>Linear in four axes</li> <li>Circular in two axes</li> <li>Circular in three axes with tilted working plane</li> <li>Helical: superimposition of circular and straight paths</li> </ul>
Block processing time	3 ms (3-D straight line without radius compensation)
Axis feedback control	<ul> <li>Position resolution: signal period of the position encoder/1024</li> <li>Position controller cycle time: 3 ms</li> </ul>
Spindle speed	Maximum 100 000 rpm (analog speed command signal)
Error compensation	<ul> <li>Linear and nonlinear axis error, backlash, reversal peaks during circular movements, thermal expansion</li> <li>Static friction, reversal error, sliding friction</li> </ul>
Data interfaces	<ul> <li>RS-232-C/V.24 max. 115 kbit/s</li> <li>Extended data interface with LSV-2 protocol for remote operation of the TNC 320 over the data interface with the TNCremo or TNCremoPlus software from HEIDENHAIN</li> <li>Gigabit Ethernet interface 1000BASE-T</li> <li>Three USB ports: one USB 2.0 port on front and two USB 3.0 ports on rear</li> </ul>
Diagnostics	Fast and simple troubleshooting through integrated diagnostic aids
Ambient temperature	<ul> <li>Operation: +5 °C to +40 °C</li> <li>Storage: -20 °C to +60 °C</li> </ul>

# HEIDENHAIN

**DR. JOHANNES HEIDENHAIN GmbH** 

Dr.-Johannes-Heidenhain-Straße 5 83301 Traunreut, Germany 會 +49 8669 31-0 FAX +49 8669 32-5061 E-mail: info@heidenhain.de

#### www.heidenhain.de

DE

AR

AT

AU

BE

BG

BR

BY

CA

СН

CN

CZ

### Vollständige und weitere Adressen siehe www.heidenhain.de For complete and further addresses see www.heidenhain.de

HEIDENHAIN Vertrieb Deutschland 83301 Traunreut, Deutschland 1 08669 31-3132 1 08669 32-3132 1 08669 32-3132	ES	FARRESA ELECTRONICA S.A. 08028 Barcelona, Spain www.farresa.es	PL	<b>APS</b> 02-384 Warszawa, Poland www.heidenhain.pl
E-Mail: hd@heidenhain.de HEIDENHAINTechnisches Büro Nord 12681 Berlin, Deutschland © 030 54705-240	FI FR	HEIDENHAIN Scandinavia AB 01740 Vantaa, Finland www.heidenhain.fi HEIDENHAIN FRANCE sarl	РТ	FARRESA ELECTRÓNICA, LDA. 4470 - 177 Maia, Portugal www.farresa.pt
HEIDENHAIN Technisches Büro Mitte 07751 Jena, Deutschland	IN	92310 Sèvres, France www.heidenhain.fr	RO	HEIDENHAIN Reprezentanță Romania Brașov, 500407, Romania www.heidenhain.ro
<ul> <li>© 03641 4728-250</li> <li>HEIDENHAIN Technisches Büro West</li> </ul>	GB	HEIDENHAIN (G.B.) Limited Burgess Hill RH15 9RD, United Kingdom www.heidenhain.co.uk	RS	Serbia <b>→ BG</b>
44379 Dortmund, Deutschland 18083-0	GR	MB Milionis Vassilis 17341 Athens, Greece	RU	OOO HEIDENHAIN 115172 Moscow, Russia www.heidenhain.ru
HEIDENHAIN Technisches Büro Südwest 70771 Leinfelden-Echterdingen, Deutschland © 0711 993395-0	HR	www.heidenhain.gr Croatia <b>→ SL</b>	SE	HEIDENHAIN Scandinavia AB 12739 Skärholmen, Sweden
HEIDENHAIN Technisches Büro Südost 83301 Traunreut, Deutschland © 08669 31-1337	HU	HEIDENHAIN Kereskedelmi Képviselet 1239 Budapest, Hungary www.heidenhain.hu	SG	www.heidenhain.se HEIDENHAIN PACIFIC PTE LTD Singapore 408593
NAKASE SRL	ID	<b>PT Servitama Era Toolsindo</b> Jakarta 13930, Indonesia E-mail: ptset@group.gts.co.id	SK	www.heidenhain.com.sg <b>KOPRETINATN s.r.o.</b> 91101 Trencin, Slovakia
B1653AOX Villa Ballester, Argentina www.heidenhain.com.ar	IL	NEUMO VARGUS MARKETING LTD. Holon, 58859, Israel	SL	www.kopretina.sk NAVO d.o.o.
HEIDENHAIN Techn. Büro Österreich 83301 Traunreut, Germany www.heidenhain.de	IN	E-mail: neumo@neumo-vargus.co.il HEIDENHAIN Optics & Electronics		2000 Maribor, Slovenia www.heidenhain.si
FCR MOTION TECHNOLOGY PTY LTD Laverton North Victoria 3026, Australia E-mail: sales@fcrmotion.com		India Private Limited Chetpet, Chennai 600 031, India www.heidenhain.in	TH	HEIDENHAIN (THAILAND) LTD Bangkok 10250, Thailand www.heidenhain.co.th
HEIDENHAIN NV 1760 Roosdaal, Belgium www.heidenhain.be	п	<b>HEIDENHAIN ITALIANA S.r.I.</b> 20128 Milano, Italy www.heidenhain.it	TR	<b>T&amp;M Mühendislik San. ve Tic. LTD. ŞTİ.</b> 34775 Y. Dudullu – Ümraniye-Istanbul, Turkey www.heidenhain.com.tr
<b>ESD Bulgaria Ltd.</b> Sofia 1172, Bulgaria www.esd.bg	JP	HEIDENHAIN K.K. Tokyo 102-0083, Japan www.heidenhain.co.jp	τw	HEIDENHAIN CO., LTD. Taichung 40768, Taiwan www.heidenhain.com.tw
HEIDENHAIN Brasil Ltda. 04763-070 – São Paulo – SP, Brazil www.heidenhain.com.br	KR	HEIDENHAIN Korea Ltd. Anyang-si, Gyeonggi-do, 14087 South Korea www.heidenhain.co.kr	UA	Gertner Service GmbH Büro Kiev 02094 Kiev, Ukraine www.heidenhain.ua
GERTNER Service GmbH 220026 Minsk, Belarus www.heidenhain.by	МХ	HEIDENHAIN CORPORATION MEXICO 20290 Aguascalientes, AGS., Mexico E-mail: info@heidenhain.com	US	HEIDENHAIN CORPORATION Schaumburg, IL 60173-5337, USA www.heidenhain.com
HEIDENHAIN CORPORATION Mississauga, OntarioL5T2N2, Canada www.heidenhain.com	MY	<b>ISOSERVE SDN. BHD.</b> 43200 Balakong, Selangor E-mail: sales@isoserve.com.my	VN	<b>AMS Co. Ltd</b> HCM City, Vietnam E-mail: davidgoh@amsvn.com
HEIDENHAIN (SCHWEIZ) AG 8603 Schwerzenbach, Switzerland www.heidenhain.ch	NL	HEIDENHAIN NEDERLAND B.V. 6716 BM Ede, Netherlands www.heidenhain.nl	ZA	MAFEMA SALES SERVICES C.C. Kyalami 1684, South Africa www.heidenhain.co.za
DR. JOHANNES HEIDENHAIN (CHINA) Co., Ltd. Beijing 101312, China	NO	HEIDENHAIN Scandinavia AB 7300 Orkanger, Norway www.heidenhain.no		
WWW.heidenhain.com.cn HEIDENHAIN s.r.o. 102 00 Praha 10, Czech Republic	NZ	<b>Llama ENGINEERING Ltd</b> 5012 Wellington, New Zealand E-mail: info@llamaengineering.co.nz		
www.heidenhain.cz	PH	MACHINEBANKS' CORPORATION		

Quezon City, Philippines 1113 E-mail: info@machinebanks.com

DK **TPTEKNIK A/S** 2670 Greve, Denmark www.tp-gruppen.dk